

WITNESS MONUMENT TIES			
ID	BEARING	DISTANCE	DESCRIPTION
Witness A	N 29d E	48.3'	MCSO "PROTECT NEARBY SURVEY MARKER" sign found 4.3' above grade on the south side of 11" utility pole #150027
Witness B	N 43d E	47.4'	Cut + in south anchor bolt of signal pole
Witness C	S 28d E	54.3'	Cut + in north anchor bolt of signal pole
Witness D	N 63d W	59.4'	Cut + in south anchor bolt of signal pole
MONUMENT ACCESSORIES			
<i>Other survey grade monuments that were located in the vicinity and their relation to the monument. Geodetic coordinates in this table are provided in the format Easting, Northing.</i>			
(#10169)	N 89d48'37" E	193.33'	3120970.78, 1426817.78 Road nail found flush at the north quarter corner of Section 02-T08N-R01W, Perry Township
(#10222)	S 12d2'42" W	51.50'	3120766.71, 1426766.78 Rebar with red cap stamped "REFERENCE POINT" set 0.2' above grade on the south side of the north mid-point of the curb island median of Clarizz Blvd.

NOTES:

1. Field work was performed on 09/25/2018 and 09/26/2018.
2. Monroe County Surveyor's Field Book 52, page 42 and Field Book 52, page 43.
3. Project Name: INDOT Network 2018, Field work by: RSO & CAR, Drawn by: RSO, Reviewed by: RSO, TER & SRB.
4. The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83_NO_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Distances obtained with GPS have not been adjusted to ground. Coordinate data and witness ties were collected with a Javad Triumph LS Network Rover.
5. Vicinity sketch was compiled per 2014 aerial photography.
6. We collected coordinates on the known monument in preparation for an upcoming INDOT resurfacing project in the area. Historic research has not yet been performed to prove the validity of this monument.


There are approximately 23 feet of uncertainty in an east/west direction associated with this monument. Please contact the Monroe County Surveyor's Office for additional information. R.Oser 5/6/2019

▲ **Monument Description:** Road nail found flush

State Plane Grid Coordinates: Point No.: 10167 Northing: 1426817.14', Easting: 3120777.46'

SHEET 1 OF 2	MONUMENT RECORD CORNER ID: Blm_S25	South 1/4 Corner Section 35- T09N-R01W Bloomington Township Monroe County, Indiana	 OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph <i>Monroe County Surveyor</i> Rachel Savich Oser <i>Professional Surveyor</i> 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-------------------------------------	--	--	---

Photos were taken on 9/25/2018 with an iPhone 6s

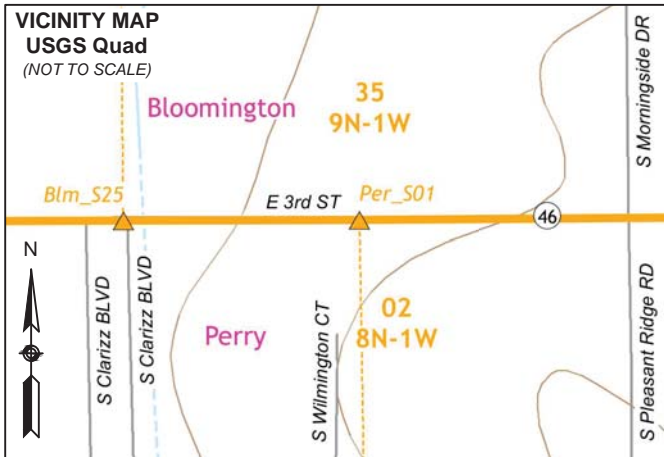

Trohn Enright-Randolph
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review Board
on 12/06/2018



Rachel Oser
Rachel Savich Oser, State of Indiana
Professional Surveyor No. 21100022

SHEET
2
OF
2

MONUMENT RECORD
CORNER ID:
Blm_S25

South 1/4 Corner
Section 35- T09N-R01W
Bloomington Township
Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
Trohn Enright-Randolph *Monroe County Surveyor*
Rachel Savich Oser *Professional Surveyor*
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570